

# Approved Vehicle Dealer Inspection Report

3823377

This report has been completed  
for

**PARADISE  
MOTORS**






## Dealer Details

Customer	<input type="text"/>	Label no	<input type="text"/>	Stock no	<input type="text"/>
Address	738 Lower North East Road, Paradise,				
Make & model	<input type="text"/>	Body type	<input type="text"/>	Build date	<input type="text"/>
Registration	<input type="text"/>				
Odometer	<input type="text"/>	VIN	<input type="text"/>		
Inspection date	<input type="text"/>	Transmission	<input type="text"/>		
Weather	<input type="text"/>	Fuel system	<input type="text"/>	Road test speed	<input type="text"/>

## Your guide to the general condition of the vehicle at the time of inspection

The Traffic Light guide below relates to the vehicle's condition at the time of inspection and does not take into consideration age, indicated kilometreage, statutory warranty or the buying or changeover price of the vehicle. Where warranty is indicated it is based on manufacturer's new vehicle warranty or in accordance with the current South Australian Second Hand Motor Vehicle Dealer Act, NOT extended warranties provided or sold by dealers.

-  **Stop:** The cost of repairs and/or the risk of future reliability/safety should be considered against the value of this vehicle and long term ownership, unless it is intended for restoration and all costs are taken into consideration.
-  **Caution:** If reported defects are repaired effectively and regular servicing maintained, the vehicle should provide reliable service. If purchasing privately or without South Australian "Dealer Statutory Warranty", all defects should be costed for repair prior to purchase. If purchasing from a dealer, roadworthy defects must be repaired at cost to dealer prior to sale.
-  **Go:** Any items reported should only require routine maintenance, adjustment or minor repairs to maintain reliable service.

**This report is not a guarantee or warranty.  
Please read all information before purchase.**  
For further information or advice with this inspection,  
please contact our Technical Advisory Service on 8202 4689.



**Important Information**

This report relates to the vehicle only. All financial arrangements and warranty conditions are between you and the RAA approved vehicle dealer.

**Content of report** - This report refers only to the items listed. Mechanical and body components are not dismantled or removed during the inspection. While every care and precaution is taken to ensure the accuracy of this report, some vehicle defects may not be evident at the time of the testing or can be spasmodic in nature and therefore not evident at the time of inspection or undetectable. The cooling system should be cleaned if the history of the vehicle is unknown. Operation of advanced electrical componentry such as in-car entertainment systems, car security systems or cruise control systems (if fitted) has not been checked.


**Brake inspection** - The Approved dealer has verified the brake linings, pads, brake discs or drums are in roadworthy condition at the time of sale therefore brake pads/linings/brake drums & discs were not inspected and report assessment is only performance based.

**Structural areas** - This inspection includes a visual inspection of the floorpan, box sections and/or inner panels to which the suspension and engine is attached, sill panels, side centre pillar, front and rear side pillars (front & rear windscreen pillars), roof panel (turret), front bulkhead (firewall the section between dash panel and engine compartment on a front engine vehicle). Although visually inspected the structural areas and wheel alignment are not measured as workshop equipment is required. Where damage or previous repairs have been identified and the inspector has reason to believe measuring is required a "yes" is entered in the relevant box below:


Damage/previous repairs have been identified to structural areas refer to items in report

We recommend a chassis alignment check prior to purchase


**Vehicle condition**

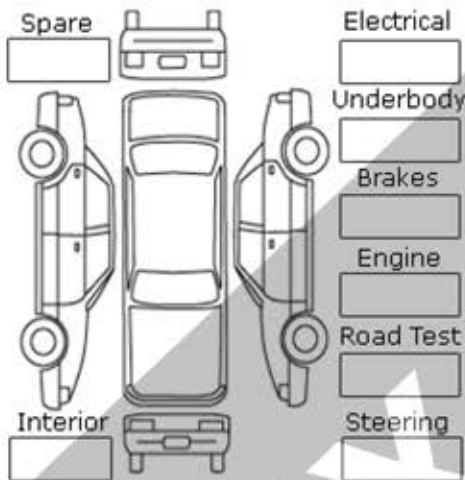

**Tyre tread depth**

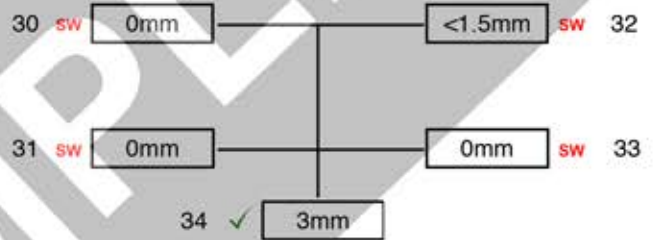

**Engine cylinder performance test**

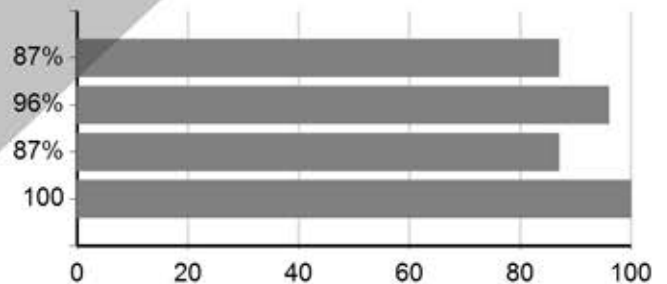


Cylinder variance 13

**Advisory note:** engine cylinder performance testing.

Relative compression testing combined with visual symptoms of oil fuming, coolant rise, defect codes and road test performance is used to determine engine cylinder performance. Relative compression testing does not identify individual cylinder compression and is purely a test to indicate potential variances. Engine cylinder performance testing does not detect oil burning, leaking head gaskets, the presence of induction air leaks or emission control device faults that affect engine performance. If variances or visual symptoms are identified during the evaluation it may be indicative of an engine performance problem and we recommend further engine testing such as direct compression testing. We are unable to perform relative engine compression testing on some Hybrid vehicles.

**Battery voltage**

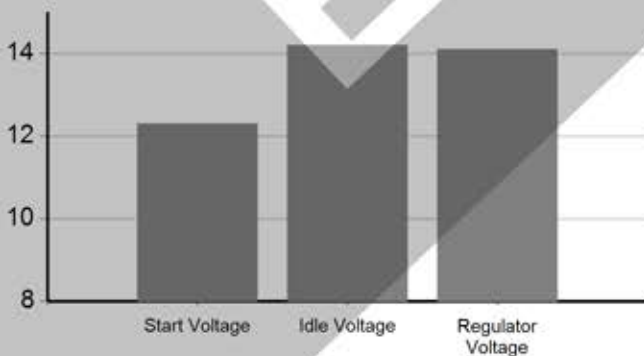

Average battery cranking voltage 10.84

Cam belt fitted? Yes

If fitted, cam belt was not inspected. If service records do not match manufacturer's recommendations, replace belt.



**Inspection checklist**

**Explanation of symbols used in this report**

- ✓** Satisfactory: Item is in serviceable condition and/or within the manufacturers specifications at time of inspection.
- NA** Not Applicable: Not applicable to vehicle or part of the inspection, or unable to access component for inspection.
- EW** Early Warranty: Requires early attention, should be repaired under statutory used vehicle or manufacturers warranty.

- M** Minor: Needs service/adjustment or monitoring for deterioration. For information, or optional repair when body or trim related.
- S** Serious Defect: Safety related, non compliance with legislation or may cause damage to the vehicle if driven before repair.
- SR** Serious (safety related) and Roadworthy defect

- E** Early Attention: Repairs are needed before vehicle is used regularly or over continuous long distance.
- R** Roadworthy: Indicates the item is non compliant with statutory regulations.
- SW** Serious Warranty: Requires urgent attention, should be repaired under statutory used vehicle or manufacturers warranty.

**Road Test**

- 1 ✓ Performance testing and noises

**Engine System**

- 2 ✓ Mount/stabiliser condition
- 3 ✓ Bearings - Main/Conrod noise
- 4 ✓ Piston/Gudgeon noise
- 5 ✓ Valve train noise
- 6 ✓ Oil Fuming/PCV system
- 7 ✓ Cylinder performance
- 8 ✓ Smoke emissions (if possible)
- 9 ✓ Oil Leaks
- 10 ✓ Oil level/condition
- 11 ✓ Engine Covers
- 12 ✓ Other Engine Noises

**Statutory Electrical Systems**

- 13 ✓ Head/Park/Driving Lights
- 14 **SW** Stop/tail/number plate lights
- 15 ✓ Turn/hazard lights
- 16 ✓ Wipers/washers
- 17 ✓ Demisters (front/rear)
- 18 ✓ Warning device (horn)
- 19 ✓ Speedometer operation
- 20 ✓ Reverse lights

**Engine Electrical System**

- 21 ✓ System warning (gauges/lights)
- 22 ✓ Charging System Operation
- 23 ✓ Starting System Operation
- 24 ✓ Battery Mounting/cabbling
- 25 ✓ Ignition
- 26 ✓ Oil Pressure Sensor
- 27 ✓ Engine Wiring

**Wheels and Tyres**

- 28 ✓ Wheel/tyre size and condition (ADR's)
- 29 ✓ Jack / tools and accessories
- 30 **SW** Pass. Side Front Tread Depth
- 31 **SW** Pass. Side Rear Tread Depth
- 32 **SW** Driv. Side Front Tread Depth
- 33 **SW** Driv. Side Rear Tread Depth
- 34 ✓ Spare Tread Depth

**Cooling System (Pressure Tested to Cap PSI)**

- 35 ✓ Visual External Radiator Condition
- 36 ✓ Radiator Cap and Seal Condition

**Cooling System (Pressure Tested to Cap PSI)**

- 37 ✓ Coolant level and visable condition
- 38 ✓ External Coolant Leaks
- 39 ✓ Combustion entry (rise test)
- 40 ✓ Cooling fan operation
- 41 ✓ Water Pump
- 42 ✓ Visual Core/welch plug condition
- 43 ✓ Radiator Hose condition
- 44 ✓ Heater / hose condition
- 45 ✓ Other drive belts (not removed)
- 46 ✓ Radiator / coolant level indicator

**Fuel Management Systems**

- 47 ✓ Air cleaner induction assembly/system
- 48 ✓ Cable/linkage/vacuum controls
- 49 ✓ Carburettor/fuel injection
- 50 ✓ Fuel tank/s, pipes and hoses
- 51 ✓ Exhaust system
- 52 ✓ EGR system

**Interior / Optional Electrical / Safety / Glass**

- 53 ✓ Map/glovebox lights
- 54 ✓ Door/footwell interior lights
- 55 ✓ Door assembly
- 56 ✓ Door glass/windscreen & tinting
- 57 ✓ Air conditioning (efficiency not tested)
- 58 ✓ Electrical operated mirrors
- 59 ✓ Gauge/instrument illumination
- 60 ✓ SRS / Air bags
- 61 ✓ Mirror glass/es
- 62 ✓ Seats
- 63 **EW** Door/boot/petrol flap locks/latches
- 64 ✓ Seat belts
- 65 ✓ Sun visor

**Steering Assemblies**

- 66 ✓ Steering Box/Rack wear and leaks
- 67 ✓ Steer. wheel/column/spline & joint wear
- 68 ✓ Power Steering
- 69 ✓ Tie-rods/steering arms/pivots/joints

**Rear / Front Axle Assemblies**

- 70 ✓ Wheel bearings noise/freeplay

**Rear / Front Axle Assemblies**

- 71 ✓ Differential and/or hub lubrication/leaks

**Front Suspension Assemblies**

- 72 ✓ Drivers side front suspension
- 73 ✓ Passenger side front suspension
- 74 ✓ or applies to both sides of the suspension

**Rear Suspension Assemblies**

- 75 ✓ Drivers side rear suspension
- 76 ✓ Passenger side rear suspension
- 77 ✓ or applies to both sides of the suspension

**Transmission Assemblies**

- 78 ✓ Oil level and Condition (if accessible)
- 79 ✓ Transmission/Transfer case/Oil leaks
- 80 ✓ Mount/stabiliser condition
- 81 ✓ Gear selectors/linkages

**Propeller / Drive Shaft Assemblies**

- 82 ✓ CV joint / driveshaft boots and leaks
- 83 ✓ CV joint/driveshaft noise/wear
- 84 ✓ Tail/front shaft joints/splines/leaks

**Braking System**

- 85 ✓ Master Cylinder (external leaks if visable)
- 86 ✓ Pedal
- 87 ✓ ABS / Stability Control
- 88 ✓ Brake Hose/Pipes condition
- 89 ✓ Park brake adjustment and operation

**Chassis & Structural Assemblies**

- 90 ✓ Previous Structural Repairs
- 91 ✓ Chassis Rails
- 92 ✓ Severe rust corrosion
- 93 ✓ Bonnet assembly
- 94 ✓ Other items

**Other systems**

- 95 **NA** Turbo System(if fitted)
- 96 **NA** LPGas system (if fitted)
- 97 ✓ Cold start operation (if engine cold)
- 98 **NA** Hub locks 4x4 (not tested under load)
- 99 **NA** Clutch operation and adjustment (if fitted)
- 100 **NA** Clutch hydraulic leaks/linkages
- 101 ✓ Oil Cooler (if fitted)

**Comments**

**Defect(s) present - attention required**

These are defects which, in our opinion, should be rectified prior to the vehicle's continued use or purchase. It is highly recommended that a Vehicle History Check be done on all vehicles prior to purchase.

Item	Image ref	Component	Comment
63	<b>EW</b>	Central Locking Remote Door Locks / Keys	Remote not working
14	<b>SW</b>	Eye/High level stop light (COPY) Stop Light	Inoperative light
30	<b>SW</b>	Tread	Depth below legal minimum
31	<b>SW</b>	Tread	Depth below legal minimum
32	<b>SW</b>	Tread	Depth below legal minimum
33	<b>SW</b>	Tread	Depth below legal minimum

**Other Items noted**

Noteworthy items which, in our opinion, should be drawn to your attention.

Item	Image ref	Component	Comment
------	-----------	-----------	---------

**Inspector's Comments**

Inspector's Signature



EXAMPLE